



Office of the Chief Fire Officer, Bengaluru-East,
Karnataka Fire & Emergency Services,
No. 04, Commissariat Road, Bengaluru-560 025.



No.216/CFO/Bng-East/FSR/2020

Dated: 07-03-2020.

ANNEXURE – B

"Group - B - Educational Building

To,
The Principal,
M/s. R L Jallappa Central School,
Mitakallahalli Village,
Near S D U M C Quarters,
Tamaka, Kolar Taluk & District - 563102.

Sir,

Sub: Issue of 'Fire Safety Recommendation' to "M/s. R L Jallappa Central School, Mitakallahalli Village, Near S D U M C Quarters, Tamaka, Kolar Taluk & District – 563102" - reg.

Ref: 1) Your request letter dated:25-02-2020.
2) Inspection report No.21/DFO/KLR/2020 Dt:04/03/2020.

<<<>>

With reference to the subject above cited, the premises of "M/s. R L Jallappa Central School, Mitakallahalli Village, Near S D U M C Quarters, Tamaka, Kolar Taluk & District – 563102" was inspected by the District Fire Office, Mahadevapura Fire Station, Bengaluru on 17-02-2020 with respect to Fire prevention, Fire fighting and Evacuation measures to be complied in the above premises and has submitted the details as under.

Part-A. Details of the building / premises :-

01	Name and Address of the Applicant.	:	The Principal M/s. R L Jallappa Central School, Mitakallahalli Village, Near S D U M C Quarters, Tamaka, Kolar Taluk & District 563102.
02	Name and Address of the premises.	:	M/s. R L Jallappa Central School, Mitakallahalli Village, Near S D U M C Quarters, Tamaka, Kolar Taluk & District 563102.
03	Name and address of the Building owner	:	M/s. R L Jallappa Central School, Mitakallahalli Village,





ADMINISTRATOR

R.L. Jallappa Central School

PP-INCIPAL
R.L. Jallappa Central School
Mitakallahalli
Kolar 563102

			Near S D U M C Quarters, Tamaka, Kolar Taluk & District 563102.
04	Number of buildings	:	01 building.
05	Number of floors	:	Ground + 2 upper floor only.
06	<u>Floor-wise details of occupancy:-</u>		
	Ground floor		01 no principal room, 11 no class rooms 01 no Library, 01 office room, 01 no admin room, 01 no staff room.
	1 st floor		07 no class rooms, 02 no computer lab, 04 no lab like physics, chemistry, biology and mathematics, 01no staff room, 01 no Physical educational room, 01 no auditorium.
	2 nd floor		06 no class room, 01staff room
07	Height of the building	:	12.00 mrts.
08	Site area	:	06.50 acres land
09.	Built-up area of each floor:-		
	Ground floor	:	1,303.70 SqMtrs.
	1 st floor	:	1,303.70 SqMtrs.
	2 nd floor	:	650.50 SqMtrs.
10.	Total built-up area	:	3,528.00 Sq. Mtrs.
11.	Surrounding properties:-		
	East (side)	:	School ground.
	West (side)	:	Private land.
	North (rear)	:	Private land.
	South (front)	:	Owner land.
	<u>Set-back area available around the building :-</u>		
	East (side)	:	25.00 mrts
	West (side)	:	12.00 mrts
	North (rear)	:	02.00 mrts
	South (front)	:	12.00 mrts.


ADMINISTRATOR
 R.L. Jalappa Central School
 Tamaka, KOLAR

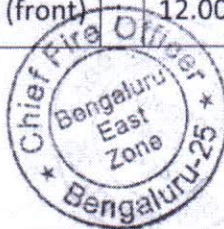



PRINCIPAL
 R.L. Jalappa Central School
 Mitakana Halli
 Bengaluru-562402

Part-B. On inspection of this Industrial premises, the following fire prevention, fire fighting and evacuation measures recommended are considered absolutely essential from fire safety point of view :-

Sl. No. (1)	Details (02)	Existing (03)	Recommendations (04)																					
01.	Accessibility to the premises	The premises are abutting 12.00 Mtrs. wide Kolar – Mulbagal main road located on the northern side.	Complied																					
02.	No. of entrances	One entry /exit is provided.	Complied																					
03.	Width of entry / exit	The width of the entry/exit is 08 Mtrs.	Complied																					
04.	Diesel generators.	Provided with one 50 KVA diesel generator & connected to all the emergency provisions in the building.	Complied																					
05.	No. of staircases available	<table border="1"> <tr> <td>Nos. of staircases</td> <td>:</td> <td>02 No</td> </tr> <tr> <td>Width of staircases</td> <td>:</td> <td>1.50Mtrs</td> </tr> <tr> <td>Width of treads</td> <td>:</td> <td>300 mm</td> </tr> <tr> <td>Height of risers</td> <td>:</td> <td>150 mm</td> </tr> <tr> <td>Nos. of riser per flight</td> <td>:</td> <td>11 per flight</td> </tr> <tr> <td>Height of handrails</td> <td>:</td> <td>1.00 mtr.</td> </tr> <tr> <td>Head room clearance</td> <td>:</td> <td>4.0 Mtrs.</td> </tr> </table>	Nos. of staircases	:	02 No	Width of staircases	:	1.50Mtrs	Width of treads	:	300 mm	Height of risers	:	150 mm	Nos. of riser per flight	:	11 per flight	Height of handrails	:	1.00 mtr.	Head room clearance	:	4.0 Mtrs.	Complied
Nos. of staircases	:	02 No																						
Width of staircases	:	1.50Mtrs																						
Width of treads	:	300 mm																						
Height of risers	:	150 mm																						
Nos. of riser per flight	:	11 per flight																						
Height of handrails	:	1.00 mtr.																						
Head room clearance	:	4.0 Mtrs.																						
06.	Fire extinguisher	12 no ABC type fire extinguisher of 4 kgs capacity and 02 no CO2 fire extinguisher capacity of 2kgs have been provided.	Complied																					
	Public address System	Provided with public addressable system in the school building.	Complied																					
07.	First aid Hose reel hose.	Provide with 03 no Hose reel hose system of 30 mtrs. Length with drum at each floor near the exits of the building which is connected to 10000 liters tank.	Complied																					
08.	Terrace tank over respective tower terrace.	Provided with Hose reel hose system in building which is connected to an overhead tank of 10,000 liters capacity	Complied																					

ADMINISTRATOR

R.L. Jalappa Central School
Tamaka, KOLAR

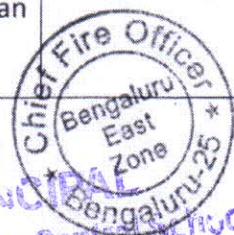

PPINCIAL
R.L. Jalappa Central School
Mudakur Hall

09.	At the terrace tank level with minimum pressure of 3.5 kg/cm ² .	Provided with One electrically booster pump capable of delivering 900 liters of water per minute near overhead tank	Complied
10.	Escape routes	Escape routes have been Marked in Which visibly to guide the students make to safer Places.	Complied
11.	Fire order	Not Displayed	A notice board written in bold indicating the action to be taken by the employees in case of any emergency should be displayed near each stair case at each floor. The notice board should contain the telephone number of the Kolar Fire Station i.e. 08152-24322, 101, and of nearby ambulance service.
12.	Fire fighting training	Not trained	At least 40% of the staff should be got trained in fire prevention Fire fighting, evacuation measures at R.A Mundkar Fire & Emergency Service Academy, Bangalore.

Under the circumstance stated above, there is No Objection to run education activity in your school building, subject to the condition of providing additional fire fighting equipments and fire precautionary measures shown in column No.4 of Part-B. Therefore, the management should comply Karnataka Fire & Emergency Services Department conditions to provide additional equipments and then intimate to this office within 90 days positively without fail. **"This Fire safety recommendation Certificate valid for Only One Year from the date of issue and is renewable without fail"**.

All requirements recommended above are as per National Building Code-2016 Part-4 clause 3.1.3 of Fire and Life safety will have to be complied with mandatorily.

Copy to District Fire Officer,
Kolar Fire Station, Kolar.



Yours faithfully,

[Handwritten Signature] 7/12/2020

Chief Fire Officer
Bengaluru East Zone
Bengaluru

[Handwritten Signature]
ADMINISTRATOR

R.L. Jalappa Central School
Tamaka, KOLAR

PRINCIPAL
R.L. Jalappa Central School
Kolar